

Page 1 of 6

Computed Tomography

FSN _72800696 Revision: 01

March 2018

URGENT - Field Safety Notice

Medical Device Correction

Ingenuity Flex, Ingenuity CT, Ingenuity Core, Ingenuity Core¹²⁸, Brilliance iCT, Brilliance iCT SP, Brilliance Big Bore Oncology, Brilliance Big Bore Radiology, Brilliance 16, Brilliance 40, Brilliance 64, IQon, Brilliance 6, Brilliance 10

Couch Horizontal Motion Controller

Dear Customer,

A problem has been detected in certain Philips CT couches used on Ingenuity Flex, Ingenuity CT, Ingenuity Core, Ingenuity Core¹²⁸, Brilliance iCT, Brilliance iCT SP, Brilliance Big Bore Oncology, Brilliance Big Bore Radiology, Brilliance 16, Brilliance 40, Brilliance 64, IQon, Brilliance 6, Brilliance 10 systems, that, if it were to re-occur, could pose a risk to patients or users. This Field Safety Notice is intended to inform you about:

- · what the problem is and under what circumstances it can occur
- the actions that should be taken by the customer / user in order to prevent risks for patients or users
- the actions planned by Philips to correct the problem.

This document contains important information for the continued safe and proper use of your equipment

Please review the following information with all members of your staff who need to be aware of the contents of this communication. It is important to understand the implications of this communication.

Please retain a copy with the equipment Instruction for Use.

If you need any further information or support concerning this issue, please contact your local Philips representative:

0800 80 3000

This notice has been reported to the appropriate Regulatory Agency.

Sincerely,

Holly Wright Lee Sr. Manager, Quality & Regulatory





Page 2 of 6

Computed Tomography

FSN 72800696 Revision: 01

March 2018

URGENT - Field Safety Notice

Medical Device Correction

Ingenuity Flex, Ingenuity CT, Ingenuity Core, Ingenuity Core¹²⁸, Brilliance iCT, Brilliance iCT SP, Brilliance Big Bore Oncology, Brilliance Big Bore Radiology, Brilliance 16, Brilliance 40, Brilliance 64, IQon, Brilliance 6, Brilliance 10

Couch Horizontal Motion Controller

AFFECTED PRODUCTS	Ingenuity Flex - 728317 Ingenuity Cor - 728326, 728325 Ingenuity Core - 728321 Ingenuity Core ¹²⁸ - 728323, 728324 Brilliance iCT - 728306 Brilliance iCT SP - 728311 Brilliance Big Bore (Oncology) - 728243 Brilliance Big Bore (Radiology) - 728244 Brilliance 16 Slice (Air) - 728246 Brilliance 16 Slice (Power) - 728240 Brilliance 40 - 728235 Brilliance 64 - 728231 IQon Spectral CT - 728332 Brilliance 6 Slice (Air) - 728256 Brilliance 10 Slice (Air) - 728251 Brilliance CT Private Practice CV config 728241
PROBLEM DESCRIPTION	Upon closing the Emergency Stop (E-STOP) the system performs an internal check. As a result of the motion controller in the couch, there is a delay in the response to the internal check. This delay may cause the couch carbon top to enter a free float state, which may allow it to move during patient load or unload activities. This free float motion results in the ESTOP being opened due to the unexpected couch motion. This issue occurs frequently after closing E-STOP. The motion controller in the couch detects a power problem and disables the horizontal motor, which allows the couch top to free-float*. *The term free float refers to the couch top being in a state that is not locked in position by the brake or being moved in a controlled fashion (manual or automatic motion).
HAZARD INVOLVED	The couch horizontal motion controller does not respond as expected, allowing the couch to free float without notification to the user once E-STOP is closed during normal use. If the couch is in free float state and the operator attempts to load a patient, serious injury to a patient and/or operator may occur due to unintended horizontal couch motion.





Page 3 of 6

Computed Tomography

FSN 72800696 Revision: 01

March 2018

URGENT - Field Safety Notice

Medical Device Correction

Ingenuity Flex, Ingenuity CT, Ingenuity Core, Ingenuity Core¹²⁸, Brilliance iCT, Brilliance iCT SP, Brilliance Big Bore Oncology, Brilliance Big Bore Radiology, Brilliance 16, Brilliance 40, Brilliance 64, IQon, Brilliance 6, Brilliance 10

Couch Horizontal Motion Controller

HOW TO IDENTIFY AFFECTED PRODUCTS

There are two sets of serial number ranges that may be impacted. Serial numbers can be either five digit or six digit numbers. The patient support (couch) serial number can be found on a label located on the front closest to the gantry of the patient support (couch) cover. Refer to Figure 1 and Figure 2 for examples of serial numbers. Refer to Table 1 and Table 2 for list of affected patient support (couch).

Figure1 (Example: six digit serial number):







Page 4 of 6

Computed Tomography

FSN _72800696 Revision: 01

March 2018

URGENT - Field Safety Notice

Medical Device Correction

Ingenuity Flex, Ingenuity CT, Ingenuity Core, Ingenuity Core¹²⁸, Brilliance iCT, Brilliance iCT SP, Brilliance Big Bore Oncology, Brilliance Big Bore Radiology, Brilliance 16, Brilliance 40, Brilliance 64, IQon, Brilliance 6, Brilliance 10

Couch Horizontal Motion Controller

Figure2 (Example: five digit serial number):



The following CT couch **six** digit serial number ranges are affected:

Table 1:

Ranges of affected six				
digit Serial Numbers				
901001 - 901992				
911001 - 911221				
921001 - 921369				
931001 - 931044				
941001 - 941137				
951001 - 951130				
957001 - 957050				





Page 5 of 6

Computed Tomography

FSN 72800696 Revision: 01

March 2018

URGENT - Field Safety Notice

Medical Device Correction

Ingenuity Flex, Ingenuity CT, Ingenuity Core, Ingenuity Core¹²⁸, Brilliance iCT, Brilliance iCT SP, Brilliance Big Bore Oncology, Brilliance Big Bore Radiology, Brilliance 16, Brilliance 40, Brilliance 64, IQon, Brilliance 6, Brilliance 10

Couch Horizontal Motion Controller

The following CT couch **five** digit serial number ranges are affected:

Table 2:

Ranges of affected five	digit Serial Numbers						
30191 thru 30194	30196	30197					
30199	30200	30202					
30204	30205	30209					
30210	30214 thru 30216	30218 thru 30226					
30228 thru 30231	30234	30235					
30237	30238	30240 thru 30257					
30263	30271	30277					
40083 thru 40086	40088 thru 40101	40103					
40104	40106	40108 thru 40112					
40117	40118	40124					
40127 thru 40143	40146 thru 40152	40155					
40157	40159 thru 40165	40167					
40169 thru 40186	40188	40189					
40191	40192	40195					
40212 thru 40215	40217						
50535 thru 50543	50545	50546					
50548 thru 50556	50558 thru 50568	50570 thru 50574					
50577	50579	50582					
50585	50597 thru 50599	50601 thru 50622					
50625	50626	50628					
50632 thru 50635	50637 thru 50640	50642 thru 50646					
50648 thru 50651	50653 thru 50655	50657					
50658	50661 thru 50663	50665 thru 50684					
50689	50691	50693					
50697	50705	50707					
60148 thru 60155	60157 thru 60163	60165					
60169	60171 thru 60187						
83200 thru 83208	83210 thru 83214	83216 thru 83220					
83223 thru 83238	83241 thru 83244	83247					
83249 thru 83251	83253	83281					
83282	83284 thru 83310	83312 thru 83314					
83317	83319	83321 thru 83339					





Page 6 of 6

Computed Tomography

FSN _72800696 Revision: 01

March 2018

URGENT - Field Safety Notice

Medical Device Correction

Ingenuity Flex, Ingenuity CT, Ingenuity Core, Ingenuity Core¹²⁸, Brilliance iCT, Brilliance iCT SP, Brilliance Big Bore Oncology, Brilliance Big Bore Radiology, Brilliance 16, Brilliance 40, Brilliance 64, IQon, Brilliance 6, Brilliance 10

Couch Horizontal Motion Controller

	83342	83345 thru 83351	83353 thru 83356	
	83358	83360 thru 83362	83365 thru 83381	
	83384	83386 thru 83359	83461 thru 83473	
	83476 thru 83487	83489 thru 83494	83496 thru 83503	
	83505 thru 83513	83515 thru 83523	83525 thru 83549	
	83551	83552	83561 thru 83564	
	83567 thru 83570	83574 thru 83577	83579 thru 83581	
	83584	83586	83587	
	83589	83593	83594	
	83596 thru 83599			
	91092 thru 91096	91098	91099	
	91101	91105 thru 91110	91112	
	91114 thru 91117	91133	91135 thru 91139	
	91141 thru 91146	91148	91151 thru 91159	
	91161 thru 91164	91166 thru 91176	91178 thru 91181	
	91183 thru 91188	91190	91192 thru 91205	
	91207 thru 91219	91237	91253	
ACTION TO BE TAKEN BY CUSTOMER / USER	Once the E-stop has been closed the operator/technologist must initiate a brief horizontal motion (in or out) using any of the operator control panels, CT-Box or tape/foot switches. This action will ensure the couch carbon top (upper pallet) is in a controlled state.			
ACTIONS PLANNED BY PHILIPS	Philips Healthcare is notifying the affected users of the issue via this Field Safety Notice. Field Change Order (FCO) 72800696 will be deployed to correct the issue. A Philips Field Service Engineer will contact you to schedule the updates at your site.			
FURTHER INFORMATION AND SUPPORT	If you need any further information or support concerning this issue, please contact your local Philips representative:			
	0800 80 3000			

