

To:

Importers and End customers

Ihr Ansprechpartner Dirk Neurohr 07355-93 14-67 Datum 07. Juli 2018

Ref: Urgent Safety Information THERA-Trainer balo / THERA-Trainer verto

Dear Sir or Madam,

We need to implement a corrective action for our products THERA-Trainer balo / THERA-Trainer verto in the field. Please note following references.

Identification of the concerned medical products:

Movement therapy device - THERA-Trainer balo, THERA-Trainer verto

Manufacturing date of all relevant medical devices is between CW21/2013 and CW04/2018 and can clearly be identified by serial number.

Serial numbers consist of A002-308-XX-**YYCW**XXXX or A002-678-XX-**YYCW**XXXX **YY** = the last two figures of the manufacturing year (e.g. 20**15**) **CW** = Calendar week of production (e.g. **07**)

Description of the problem including the determined cause:

The hexagon socket set screw of the mounting mechanism of the knee support is broken.





Kreissparkasse Biberach BLZ 654 500 70 KTO 23 14 IBAN DE88654500700000002314 SWIFT SBCRDE66



Picture: THERA-Trainer verto

 Commerzbank Biberach
 Geschä

 BLZ 654 400 87
 Peter K

 KTO 130 45 67
 Rgr. UL

 IBAN DE20654400870130456700
 HRB 64

 SWIFT COBADEFF654
 USt.-Id

Geschäftsführer Peter Kopf/Otto Höbel Rgr. Ulm HRB 640839 USt.-IdNr. DE144890393

Blumenweg 8 88454 Hochdorf Tet +49 7355-93 14-0 | Fax -15 www.thera-trainer.de info@thera-trainer.de





Picture: Broken hexagon socket set screw

As a cause, we detected a hydrogen embrittlement of the galvanized hexagon socket set screw with the strength ≥ 10.9. This hydrogen embrittlement can occur irregularly. The damage can happen during low load already. If the hexagon socket set screw breaks, the knee support can fall of on one side and the patient will become instable during lifting process or during therapy.

Health risk:

We carried out an evaluation of the health risk, in order to identify potentially harmful situations that might occur if the hexagon socket set screw breaks suddenly. The highest possible level of harmful situation for the patient is injury to the skin (e.g. laceration) which needs medical attendance.

Until now, we faced no injuries in connection to this problem.

There are no risks for patients that were already treated with the device, as well as for users and third persons.

Which measurements need to be taken in action by the receiver?

During this corrective action, we kindly ask you to do the following:

- Please stop exercising with THERA-Trainer balo/THERA-Trainer verto until a modification was done.
- We, medica Medizintechnik GmbH, will send you within the next 2-3 weeks spare parts incl. service
 manual in order to exchange the relevant components. Please exchange the components and return
 the original components incl. the completed answer form to us.



Transferring the information described above:

Please take care that the safety information provided reaches all persons necessary within your organization or other organizations that were in touch with the relevant products.

Please distribute this safety information to other organizations, which might be concerned by the action, and ensure that the corrective action stays public until it is closed.

The Federal Institute for Drugs and Medical Devices received a copy of this "urgent safety information".

Contact Person:

Dirk Neurohr, Head of Service & Quality medica Medizintechnik GmbH

E-Mail: dirk.neurohr@thera-trainer.de

Phone: 07355/9314-67

Homepage: www.thera-trainer.de

With kind regards,

medica Medizintechnik GmbH

Blumenweg 8 88454 Hochdorf GERMANY Tel. +49 7355-93 14-0 Fax +49 7355-93 14-15 info@thera-trainer.de www.thera-trainer.de

i.A. Dirk Neurohr



Product description:

Customer Answer Form

Ref: Urgent safety information THERA-Trainer balo / THERA-Trainer verto

THERA-Trainer balo / THERA-Trainer verto

Manufactured between CW21/2013 and CW04/2018

Serial number: Our reference no.:	Beginning with A002-308 or A002-678 PKOHDN20180515
CONFIRMATION OF	RECEIPT OF THE SAFETY INSTRUCIONS AND COMPLETION OF THE ANSWER FORM
Please tick the applying	boxes below and return the completed form to us:
actions. We confirm the	-safety instructions and understand the information given as well as the required receipt of the spare parts and the implementation of the exchange. Please inform us which device, when and who did the exchange.
Serial number:	
Company/Facility:	
Date of the exchange:	
Name / Title of the per charge:	son in
Serial number:	Please give us the contact date of the <u>new</u> facility.
Name of the new facili	
Name / Title of contact person:	
Adress:	
City, Zip Code, Countr	у:
Phone:	
E-Mail:	
☐ The THERA-Trainer	balo / THERA-Trainer verto is no longer in the field!
Serial number:	
Company/Facility:	
Name / Title of the conperson:	itact
We offer following ways	of contact:

medica Medizintechnik GmbH_

+49 7355-93 14-15

service@thera-trainer.de

Blumenweg 8 88454 Hochdorf Tel +49 7355-93 14-0 | Fax -15 www.thera-trainer.de info@thera-trainer.de

Mail:

Fax: E-Mail:

> Kreissparkasse Biberach BLZ 654 500 70 KTO 23 14 IBAN DE88654500700000002314 SWIFT SBCRDE66

medica Medizintechnik GmbH, Blumenweg 8, D-88454 Hochdorf

Commerzbank Biberach BLZ 654 400 87 KTO 130 45 67 IBAN DE20654400870130456700 SWIFT COBADEFF654 Geschäftsführer Peter Kopf/Otto Höbel Rgr. Ulm HRB 640839 USt.-IdNr. DE144890393